

CE **OIO-**Link C US

Model Number

OBT150-R101-2EP1-IO

Triangulation sensor (BGS) with 2 m fixed cable

Features


- Miniature design with versatile • mounting options
- Best background suppressor in its ٠ class
- Precision object detection, almost • irrespective of the color
- Extended temperature range ٠ -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and . process data

Product information


The miniature optical sensors are the first devices of their kind to offer an end-to- end solution in a small single standard design from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.


The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

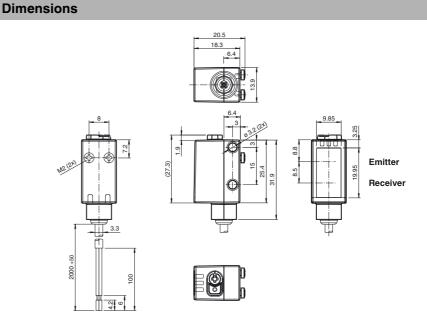

Electrical connection

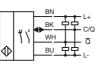

Indicators/operating means

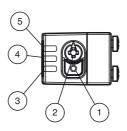

1	Light-on/dark-on changeover switch	
2	Sensing range adjuster	
3	Operating indicator / dark on	
4	Signal indicator	
5	Operating indicator / light on	

Pepperl+Fuchs Group

www.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com ⁵ PEPPERL+FUCHS 1

Technical data		
General specifications		5 450 mm
Detection range		5 150 mm 5 25 mm
Detection range min. Detection range max.		5 25 mm
Adjustment range		25 150 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black/White difference (6 %/90 %))	< 5 % at 150 mm
Diameter of the light spot		approx. 10 mm at a distance of 150 mm
Angle of divergence		approx. 3 °
Ambient light limit		EN 60947-5-2 : 40000 Lux
Functional safety related parame	eters	
MTTF _d		600 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
ndicators/operating means		
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - object detected constantly off - object not detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	UB	10 30 V DC
Ripple		max. 10 %
No-load supply current	I ₀	< 25 mA at 24 V supply voltage
Protection class		III
nterface		
Interface type		IO-Link (via C/Q = BK)
Device profile		Smart Sensor
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh SIO mode support		Process data input 1 Bit Process data output 2 Bit yes
Device ID		0x11060F (1115663)
Compatible master port type		A
Dutput		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally closed / dark-on, PNP normally op light-on, IO-Link /Q - Pin2: NPN normally open / light-on, PNP normally closed dark-on
Signal output Switching voltage		2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected max. 30 V DC
Switching current		max. 30 v DC max. 100 mA . resistive load
Usage category		DC-12 and DC-13
Voltage drop	Ud	≤ 1.5 V DC
Switching frequency	f	500 Hz
Response time		1 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F) , fixed cable -25 60 °C (-13 140 °F) , movable cable not appropriate conveyor chains
Storage temperature		-40 70 °C (-40 158 °F)
Aechanical specifications		
Housing width		11 mm
		37.1 mm
Housing height		21.5 mm
Housing depth		IP67 / IP69 / IP69K
Housing depth Degree of protection		2 m fixed cable
Housing depth Degree of protection Connection		2 m fixed cable
Housing depth Degree of protection Connection Material		
Housing depth Degree of protection Connection		2 m fixed cable PC (Polycarbonate) PMMA

IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

Other suitable accessories can be found at www.pepperl-fuchs.com

Pepperl+Fuchs Group I www.pepperl-fuchs.com fa-in

2

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

Cable length


2 m


Approvals and certificates


UL approval

E87056 , cULus Listed , class 2 power supply , type rating 1

Curves/Diagrams

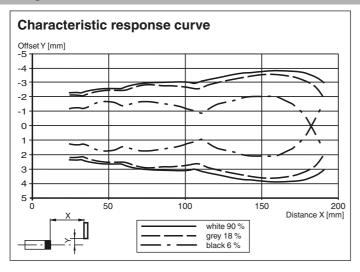

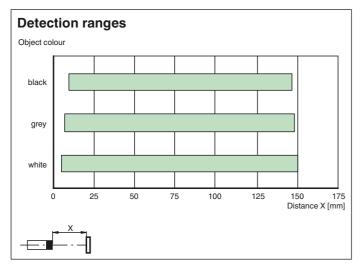

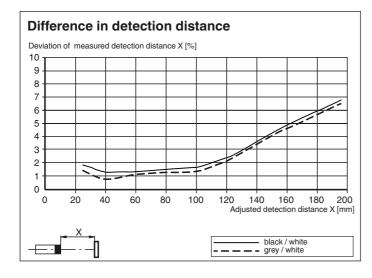

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group USA: +1 330 486 0001


www.pepperl-fuchs.com

fa-info@us.pepperl-fuchs.com


Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

EPPPERL+FUCHS 3

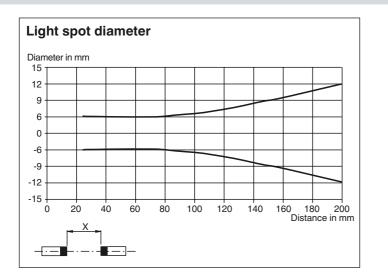

Functions and Operation

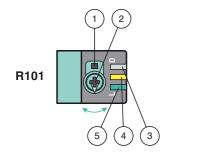

- 1 Light-on / dark-on changeover switch
- 2 Sensing range /sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range /sensivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on / dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensivity adjustment is locked. In order to reactivate the sensing range / sensivity adjustment, turn the sensing range / sensivity adjuster for more than 180 degrees.

www.pepperl-fuchs.com