OBT350-R100-2EP-IO-0,3M-V1-IR

Dimensions





CE **OIO**-Link US

Model Number

OBT350-R100-2EP-IO-0,3M-V1-IR

Triangulation sensor (BGS) with fixed cable and M12 connector, 4-pin

Features

- Miniature design with versatile • mounting options
- Best background suppressor in its ٠ class
- Precision object detection, almost • irrespective of the color
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and process data


Product information

The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

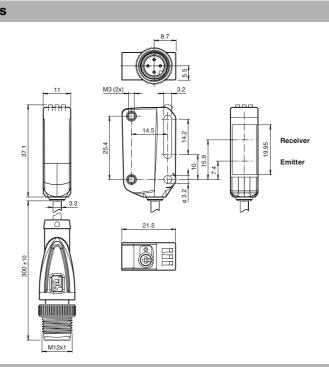


Electrical connection







Indicators/operating means



1	Light-on / dark-on changeover switch		
2	Sensing range adjuster		
3	Operating indicator / dark on		
4	Signal indicator		
5	Operating indicator / light on		

Date of issue: 2018-12-19 Release date: 2018-12-19 10:14

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



eng.xml

Technical data		
General specifications Detection range		5 350 mm
Detection range min.		5 25 mm
Detection range max.		5 350 mm
Adjustment range		25 350 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated infrared light 850 nm
LED risk group labelling		exempt group
Black/White difference (6 %/90 %)		< 15 % at 350 mm
Diameter of the light spot		approx. 26 mm at a distance of 350 mm
Angle of divergence		approx. 4 °
Ambient light limit		EN 60947-5-2 : 40000 Lux
Functional safety related parame	ters	600 a
MTTF _d Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0%
Indicators/operating means		0,0
Operation indicator		LED green:
		constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - object detected
		constantly off - object not detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	UB	10 30 V DC
Ripple		max. 10 %
No-load supply current	I ₀	< 25 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type Device profile		IO-Link (via C/Q = pin 4) Smart Sensor
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh		Process data input 1 Bit
		Process data output 2 Bit
SIO mode support		yes
Device ID		0x11060A (1115658)
Compatible master port type		A
Output		The suitables time of the concertis editatable. The default
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / light-on, PNP normally closed / dark-on, IO-Link /Q - Pin2: NPN normally closed / dark-on, PNP normally open / light-on
Signal output		2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U _d	≤ 1.5 V DC
Switching frequency	f	500 Hz
Response time		1 ms
Conformity		IEC 61121 0
Communication interface Product standard		IEC 61131-9 EN 60947-5-2
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		11
Housing width		11 mm
Housing height		44.5 mm
Housing depth Degree of protection		21.5 mm IP67 / IP69 / IP69K
Connection		300 mm fixed cable with M12 x 1, 4-pin connector
Material		
Housing		PC (Polycarbonate)
Optical face		РММА
Mass		approx. 10 g

Accessories
IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection
V31-GM-2M-PUR Female cordset, M8, 4-pin, PUR cable
V31-WM-2M-PUR Female cordset, M8, 4-pin, PUR cable
Other suitable accessories can be found at www.pepperl-fuchs.com

www.pepperl-fuchs.com

USA:+1 330 466 0001 Germany:+49 621 776 4411 fa-info@us.pepperl-fuchs.com fa-info@de.pepperl-fuchs.com

1 776 4411 Singapore rl-fuchs.com fa-info@sg.pe

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com





2


Approvals and certificates UL approval

E87056, cULus Listed, class 2 power supply, type rating 1

Curves/Diagrams

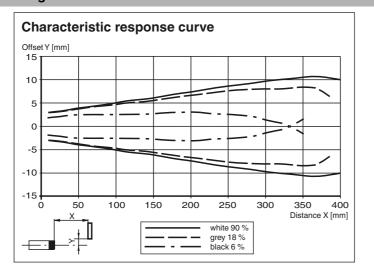


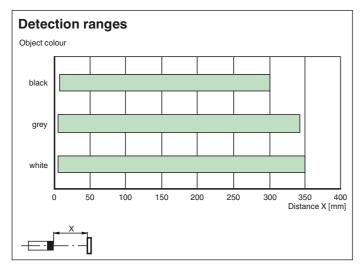

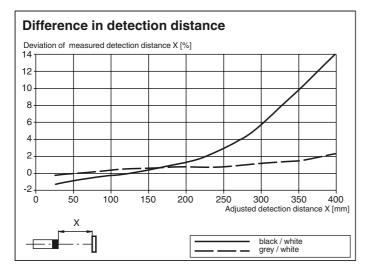


Release date: 2018-12-19 10:14 Date of issue: 2018-12-19 267075-100497_eng.xml



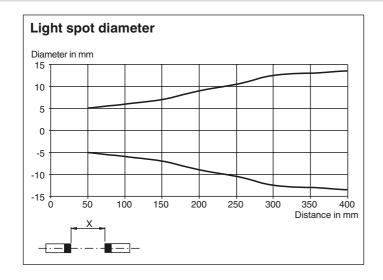

Functions and Operation

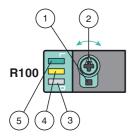

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.

Δ

fa-info@us.pepperl-fuchs.com

