

CE IO-Link

## **Model Number**

# OBT350-R101-2EP-IO-0,3M-V31-1T

Triangulation sensor (BGE) with fixed cable and 4-pin, M8 connector


## **Features**

- Miniature design with versatile • mounting options
- Secure and gapless detection, even ٠ near the surface through background evaluation
- Precision object detection, almost ٠ irrespective of the color
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and • process data


## **Product information**

The miniature optical sensors are the first devices of their kind to offer an end-to- end solution in a small single standard design from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks. The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

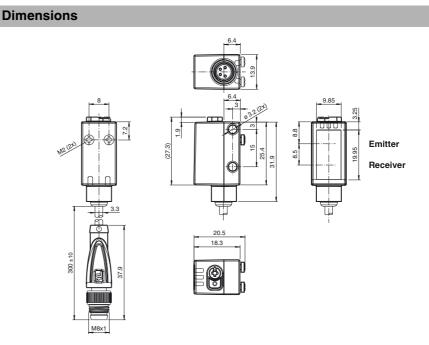


## **Electrical connection**

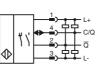

## Pinout



## Indicators/operating means

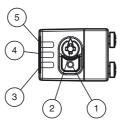

	1	Light-on/dark-on changeover switch
	2	Sensing range adjuster
	3	Operating indicator / dark on
<ul><li>4 Signal indicator</li><li>5 Operating indicator / ligh</li></ul>		0
		Operating indicator / light on

Refer to "General Notes Relating to Pepperl+Fuchs Product Information" Pepperl+Fuchs Group www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

<sup>5</sup> PEPPERL+FUCHS 1

Technical data		
General specifications		
Detection range		5 350 mm
Detection range min.		5 25 mm
Detection range max.		5 350 mm
Adjustment range		25 350 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black/White difference (6 %/90 %)	)	< 15 % at 350 mm
Diameter of the light spot		approx. 20 mm at a distance of 350 mm
Angle of divergence		approx. 3 °
Ambient light limit		EN 60947-5-2 : 40000 Lux
Functional safety related parame	eters	
MTTF <sub>d</sub>		600 a
Mission Time (T <sub>M</sub> )		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operation indicator		LED green:
		constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow:
		constantly on - background detected (object not detected) constantly off - object detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	UB	10 30 V DC
Ripple		max. 10 %
No-load supply current	I <sub>0</sub>	< 25 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type		IO-Link ( via C/Q = pin 4 )
Device profile		Smart Sensor
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh		Process data input 1 Bit Process data output 2 Bit
SIO mode support		yes
Device ID		0x110701 (1115905)
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is:
		C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link /Q - Pin2: NPN normally closed / light-on, PNP normally open /
O'read autout		dark-on
Signal output		2 push-pull (4 in 1)outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage Switching current		max. 30 V DC max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	Ud	≤ 1.5 V DC
Switching frequency	0 <sub>d</sub> f	500 Hz
Response time	•	1 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F) , fixed cable
Ambient temperature		-25 60 °C (-13 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Housing width		13.9 mm
Housing height		33.8 mm
Housing depth		18.3 mm
Degree of protection		IP67 / IP69 / IP69K
Connection		fixed cable 300 mm with M8 x 1 male connector; 4-pin
Material		
Housing		PC (Polycarbonate)
Optical face		РММА
Mass		approx. 17 g

Ac	cess	ories
----	------	-------

IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

V31-GM-2M-PUR Female cordset, M8, 4-pin, PUR cable

## V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable

Other suitable accessories can be found at www.pepperl-fuchs.com

www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com


2

#### Cable length


0.3 m

#### Approvals and certificates UL approval

E87056, cULus Listed, class 2 power supply, type rating 1

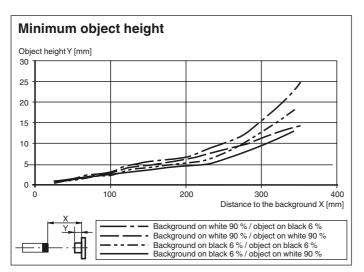

### **Functions and Operation**

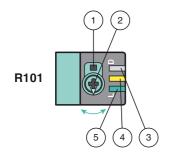

- 1 Light-on / dark-on changeover switch
- 2 Sensing range /sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster for more than 180 degrees.

#### Sensing Range / Sensitivity

Turn sensing range / sensivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range /sensivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

## Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on / dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

## **Restore Factory Settings**

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensivity adjustment is locked. In order to reactivate the sensing range /sensivity adjustment, turn the sensing range / sensivity adjuster for more than 180 degrees.

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com